Zeitschrift: IABSE reports = Rapports AIPC = IVBH Berichte

Band: 60 (1990)

Artikel: Epoxy bonded steel plate method for repairing deteriorated slabs

Autor: Sonoda, Keiichiro / Matsui, Shigeyuki / Hayqashi, Hidenao

DOI: https://doi.org/10.5169/seals-46572

Nutzungsbedingungen

Die ETH-Bibliothek ist die Anbieterin der digitalisierten Zeitschriften auf E-Periodica. Sie besitzt keine Urheberrechte an den Zeitschriften und ist nicht verantwortlich für deren Inhalte. Die Rechte liegen in der Regel bei den Herausgebern beziehungsweise den externen Rechteinhabern. Das Veröffentlichen von Bildern in Print- und Online-Publikationen sowie auf Social Media-Kanälen oder Webseiten ist nur mit vorheriger Genehmigung der Rechteinhaber erlaubt. Mehr erfahren

Conditions d'utilisation

L'ETH Library est le fournisseur des revues numérisées. Elle ne détient aucun droit d'auteur sur les revues et n'est pas responsable de leur contenu. En règle générale, les droits sont détenus par les éditeurs ou les détenteurs de droits externes. La reproduction d'images dans des publications imprimées ou en ligne ainsi que sur des canaux de médias sociaux ou des sites web n'est autorisée qu'avec l'accord préalable des détenteurs des droits. En savoir plus

Terms of use

The ETH Library is the provider of the digitised journals. It does not own any copyrights to the journals and is not responsible for their content. The rights usually lie with the publishers or the external rights holders. Publishing images in print and online publications, as well as on social media channels or websites, is only permitted with the prior consent of the rights holders. Find out more

Download PDF: 27.11.2025

ETH-Bibliothek Zürich, E-Periodica, https://www.e-periodica.ch

Epoxy Bonded Steel Plate Method for Repairing Deteriorated Slabs

Réparation de dalles en béton à l'aide de plaques d'acier collées à la résine époxyde

Reparatur von Stahlbetonplatten mit Epoxy-geklebten Stahlblechen

Keiichiro SONODA

Professor Osaka City Univ. Osaka, Japan

Shigeyuki MATSUI

Associate Professor Osaka, Univ Osaka, Japan

Hidenao HAYASHI

Chief Research Engineer Hanshin Expr. Publ. Corp. Oasaka, Japan

1. INTRODUCTION

In Japan, for repairing cracked and damaged RC decks of bridge, several methods have been developed. Among them, Epoxy Bonded Steel Plate Method is most familiar. The method is of a reinforcement by bonding a thin steel plate to the bottom surface of deteriorated deck with the aid of adhesion of epoxy resin. The repaired deck behaves like a steel plate and concrete composite slab. A main advantage of this method is that the repair work can be done without stopping a traffic service on deck. This method is executed through the following steps: (1) Holes in the bottom surface of RC deck are made and an anchor bolt is inserted into each hole. (2) A sheet of thin steel plate with a certain width is installed in the anchor bolts with keeping a clearance for epoxy resin grouting layer. (3) After all edges of steel plate are sealed with a sealing material, epoxy resin is grouted by an injection pump. The main purpose of this study is to examine reliability of the method. For sake of this, static and fatigue tests of repaired and non-repaired slabs of model composite girder bridges were carried out under vehicle loadings.

2. METHOD OF EXPERIMENT

tests slabs supported by a twin girder bridge spanning over 3.6m have 8cm thick, main re-bars in 10cm pitch and distribution re-bars in 15cm pitch, which were modeled to an existing RC deck slab on a typical highway road bridge in Japan. A full size truck cyclically running on six composite girder bridges arranged on a circular test road was used, as shown in Photo. 1. Three steps of tests were carried out. The first was static tests by a central patch load on the slabs. The second was fatigue loading tests before repairing, in order to give some degrees of deterioration to the slabs. The third was fatigue loading tests after repairing. Through those steps, the mechanical behavior of repaired and non-repaired slabs was examined, in particular on cracking pattern, debonding of steel plate, degradation of stiffness and so on. The six test slabs named No.1 to No.6 have the same sizes and reinforcements. The load intensity truck rear wheel in running was set to 51kN for slabs Nos.1, 3 and 5 and to 42kN for slabs Nos.2, 4 and 6. Slabs Nos.1,2,3 and 4 were repaired after finite number of loading cycles. Slabs Nos. 5 and 6 remained non-repaired for monitoring. The higher load intensity of rear wheel applied were corresponding to about 1.5 times as large as an equivalent design load specified by the Japanese code [1].

3. RESULTS

Figure 1 shows variations of elastic deflection under the central rear wheel load, which mean the degradation of stiffness of slab. Non-repaired slab No.5 collapsed at about 160000 cycles, and slabs Nos. 1 and 3 with the same loading condition as No.5 were repaired at 17000 and 160000 cycles, respecti-While, slabs Nos.2 and 4 subjected to a lighter loading condition were repaired at earlier stages of 5000 and 17000 cycles, respectively. All test slabs except No.5 did not collapse until 600000 cycles when the tests ceas-



Photo. 1 Test View

The collapse mode occurred in slab No.5 was like a punching shear mode without fracture of re-bars. By taking a view of the cross section sawn out after the tests were over, it was known that diagonal shear cracks in concrete might appear at earlier stage, but so severe debonding of steel plate to lead a shear bond failure soon was not seen yet, though only some ofsmall parts of debonding of steel plate occurred from small cavities within epoxy resin layer, which seemed to be already made at the repair stage.

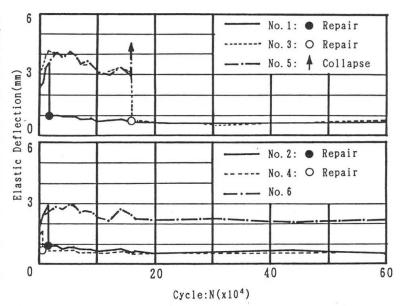


Fig. 1 Relationship between Loading Cycle and Elastic Deflection at Center

4. CONCLUSION

- 1. Epoxy Bonded Steel Plate
 Method is reliable as a
 repair method for cracked and damaged RC slabs of bridge deck even at the
 stage of so severe damage as to cause diagonal shear cracks in concrete,
 provided that its careful work not to include any cavity in epoxy resin grouting layer is done.
- 2. Slabs repaired by the method behave as a full-composite slab consisting of compressive concrete and tensile steel plate.
- 3. Most of peeling or debonding of the steel plate are caused by initial cavities in epoxy resin grouting layer. So, careful work is required to raise reliability of the method.

REFERENCES

- 1. Japan Road Association, Specification for Highway Bridges. 1980.
- 2. SONODA, K., OKINO, M., HAYASHI, H. and KITA, H., Reliability of epoxy bonded steel plate method for repairing damaged RC slabs of bridge. Proceedings of JSCE, I-10, Oct. 1988. (in Japanese)